



Service Bulletin

Issued by Canon Europa N.V.

**Copier B/W
SOFTWARE**

Model:

iR2016
iR2020

Ref No.:

F1-T01-0L7-10047-01

Date:

May 2006

Location:

iR2016/2020 System Software

Subject:

Releasing the iR2016/2020 Series System Software v15.01

Releasing System CD-ROM:

FY9-4239-003: System Software v1501

[New history of release]

Service Info.# / System DC-Rom #/ Date	Version / Modifications
/ FY9-4239-003 / May 22, 2006	System /1501 Boot Rom /1403 32M-OPT /1501 -Modification of the misspelling in Korean

[Old history of release]

Service info.No. / System CD- ROM Parts No.	Version No.			Modifications
	System	Boot ROM	32M- OPT	
F1-T01-0L7- 10046-01/-	-	1403	-	Upgrade of Boot Rom (Change that accompanies process modification of factory.)
F1-T01-0L7- 10040-01/FY9- 4239-002	WLaa14 03	WLaa13 01	WLaa14 03	<p>1) Measure against the ADF Jam</p> <p>2) Specification was changed, so that when using the device without document detection and setting "Two-page Separation" and "Original Frame Erase", copying can be performed on the basis of the document size which the user sets.</p> <p>3) Modification was made on the LUI and RUI since various settings were not reflected for each country type. - As for the Chinese model, modification was made, so that you cannot set "Redial Interval" of "Auto Redial" function within 4 minutes. - As for the Taiwanese model, modification was made, so that you cannot set "Redial Interval" of "Auto Redial" function within 3 minutes.</p> <p>4) Modification was made on RUI since various settings were not reflected for each country type. - As for the Korean model, modification was made, so that you cannot enter "Fax Number" more than 40 digits. - As for the models which "Telephone Line Type" was not supposed to be selectable, modification was made, so that this setting item is not displayed on the device.</p>

F1-T01-0L7-10034-03/	-	-	-	1) Service Parts Report 2) add a note Upgrading When Installing the Optional ROM
F1-T01-0L7-10034-02/	-	-	-	Affected Machines Report
F1-T01-0L7-10034-01/	13.01 (BF0D)	13.01 (FBE4)	13.01 (FB1F)	Bug Fix 1) When you set the page separation and reduction copy functions, the image sensor unit collides with the right side of the reader part 2) When you set the page separation and book frame erase functions, an image failure occurs. 3) When making copies from the ADF with the frame erase and copy reduction settings, shadows and frame lines at the trailing edge are not erased. 4) When you set the page separation and reduction copy functions, an image failure occurs.
F1-T01-0L7-10028-01/	11.01 (BF0C)	11.01 (EF54)	11.01 (EE8F)	1) Measures against dust detection problem on the stream reading glass at stream reading from ADF 2) Measures against reboot problem of iR device when languages except EFIGS are used for IE (Internet Explore languages when using RUI.
F1-T01-0L7-10026-01/	10.04 (E9E3)	10.04 (BF12)	10.04 (E91E)	1) Correction of a fax jam problem 2) Correction of a AE problem 3) Change of PCL activation
F1-T01-0L7-10026-01/	9.07	9.07	9.07	First release

Details:**1. Changes made when upgrading from System Software v1403 to v1501:**

T-1

	Item	Description
1	Modification of the misspelling in Korean	As for Korean only, the misspelling in the message is modified.

2. Version Configuration:

The operating guarantee of the iR2020/2016 System Version 1501 is undertaken for the following combinations.

System	Boot ROM	32M-OPT	ECNT	OPCST	DUPLEX	Fin ZW2
1501	1403	1501	2.17/3.02/5.02/6.01	0.04	0.03	4.03

*Changes are colored in red.

3. Temporary Countermeasure:

None.

4. Service Parts:

None.

5. Affected Machines:

We will inform you as soon as it is clarified.

6. Classification:

We will inform you as soon as it is clarified.

Note 1 :

Upgrading When the Optional ROM is Installed

When installing the following options, the optional ROM (32MB) included in the package must be installed. Installation of the optional ROM enables the controller to operate on the firmware of the optional ROM.

Therefore, when installing the optional ROM, be sure to check the versions of the main controller, Boot ROM, and optional ROM, and when the versions do not match, upgrade the version by SST to match them.

Options for which the optional ROM is included in the package:

-PCL Printer Kit-J1

Note 2 :

Upgrading When Installing the Optional ROM

The optional ROM holds the firmware of the main controller in addition to that for additional functions. Its installation will cause the controller to operate according to the firmware instructions of the optional ROM.

For this reason, it is important to check the version of the main controller, boot ROM, and optional ROM when installing the optional ROM, while upgrading as necessary to ensure version compatibility.

Further, if the optional ROM has been installed, it is also necessary to execute 'all clear' for the expansion of data. Be sure to 'export' the user data using the RUI or service mode before executing 'all clear', and to 'import' it after executing 'all clear'.

Accessories That Come with the Optional ROM

-PCL Printer Kit-J1

Importing/Exporting User Data

-if using service mode (SSSW>SYSTEM SW>SW03), connect the USB cable.

-if using the RUI (set initial settings>import/export), connect the network cable.