

# Firmware Release Note

<b>Model :</b> SL-M3370FD, M3375FD, M3870FD, M3870W, SL-M3870FW, M3875FD, M3875FW, M4070FR, SL-M4072FD, M4075FR, M4072FD, M3875HD,	<b>Date :</b>	<b>May 24, 2017</b>
--	---------------	---------------------

Version	Category	Change Description
<b>V4.00.01.16</b> (26-Mar, 2014)	Fix Defect	Fixed the copy fail issue.
	Fix Defect	Easy Printer Manager doesn't update downloaded font list when multi font download using PJI
<b>V4.00.01.27</b> (23-Dec, 2014)	Add Func.	Add a new error code (M3-1112, Jam Inside of Machine)
	Fix Defect	OTG cable compatibility
		Remove unused Network Port such as TCP 22 port.
		Can not upload CA certification from SyncThru Web Service.
Fix Google Cloud Print issues.		
<b>V4.00.01.28</b> (4-Feb, 2015)	Add Func.	Apply to Samsung Cloud Print Function.
<b>V4.00.01.30</b> (5-Oct, 2015)	Add Func.	Apply to Toner Status and Easy setup of Samsung Cloud Print
		Apply the new font in PCL5, PCL6, Postscript
		Support for SPDS Android App.(for repair service)
		Support Proxy Server Authentication
		Scan to SMB/FTP maximum users should be increased from 20 to 200
	Fix Defect	GCP print & deregistration doesn't work properly
		Google Cloud print with proxy connection is not working as expected
		occur memory leak when GCP confirm popup is displayed on LUI
		Time Zone is not getting Applied and Changed in DST.
		[SWAS Job Accounting] Device didn't send a reponse to SWAS
		[SyncThruAccount][NoHDD] Missing the job record count when many jobs are running
		To avoid POODLE/FREAK attack in OpenSSL V3 version
		Russia summer time issue
		Toner replacement alert is displayed in UI even when part replacement alert is made OFF in Tech Mode.

<b>V4.00.01.32</b> (11-Feb, 2016)	Fix Defect	Two function for Israel GOV Tender were missing from F/W V4.00.01.29. - Need Email & SMB scan with shortcut. - "Speed dial" do not work when "Prefix dial" set
		Can not able to proceed the scan to SMB job on touch panel of machine
<b>V4.00.02.07</b> (11-May, 2016)	Add Func.	Add Best Buy additional cloning items
	Fix Defect	The Wakeup event settings between in Machine setting and Information page are different
		Change for Fuser error condition
		Improve USB PDF Printing speed issue
		Change the clear text default value "Normal" to "Off"
		Fixed wrong consumable URL
		Cloning SNTP Sever value failed
		IPv4 Address is changed to DHCP from static when device is rebooted
Add Recovery logic for NAND file system broken case. To prevent infinitely system rebooting case.		
<b>V4.00.02.09</b> (31-May, 2016)	Add Func.	Support a new product.(for Hangtion in China)
	Fix Defect	Printer is restarting if user gives test page print after installing CD Driver.
<b>V4.00.02.13</b> (26-Aug, 2016)	Fix Defect	Machine Settings,Network Settings,System Security,Network Security,User access control values are not retaining after firmware upgrade
		Fix for Fax, Email settings and Address book erase is applied.
<b>V4.00.02.16</b> (19-Apr, 2017)	Fix Defect	Scan to SMB Performance issue
		Device will not reboot after accessing the shared folder on the printer.
		Scan to Email for the office365 and Gmail Not working
		Scan to SMB data transfer speed is slower in Threadx FW
	Add Func.	Add PrinterOn V2.0
<b>V4.00.02.18</b> (27-May, 2017)	Fix Defect	Fixed network blocking issue in some unstable network environments
		Fixed the rebooting issue when boot up for 4070FR(SD card model only)

※ Note

- Please do not turn off the printer and your computer until firmware update finishes.
  - If you are using USB connection, disconnect all other USB printers from the PC.
  - The firmware update you are about to install has been tested for compatibility with Samsung toner cartridge products ONLY.
- Installing The upgrade may cause a non-Samsung toner cartridge to malfunction.
- Do not run your printer during the firmware update.(Do not have any print job)

## How to update the firmware using a USB cable.


1. Make sure that the machine is connected to the PC with a USB cable.
2. Set the firmware upgrade 'ON' in the tech mode.

To enter the Tech Mode, press “ Menu, #, 1, 9, 3, 4 ” in sequence

Set the firmware upgrade 'on' in service function

3. Drag the firmware file(\*.hd) and Drop down it on usblast2.exe.

And then, firmware update will be started automatically.

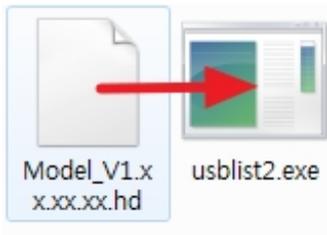

4. The firmware update will start.

Once the firmware update is complete, the machine will be rebooted automatically.

## Updating from the Network

1. Go to the SyncThruWeb Service (SWS) main home page.

Login as Admin in SyncThruWeb Service.

NOTE: Login using the Administrator ID and Password established during initial machine setup.

2. Click [Maintenance] on the top menu.

And then click [Firmware Upgrade] or Application Management > Application

3. Click Add button

4. Click [Browse]. Choose installation file by browsing file system. And click OK button

5. The uploading step will start. After this step, next step will be started automatically.

6. The firmware update will start.

7. Once the f/w update is complete, the machine power-off and power-on automatically.